

100% HMPE Eye Splice


This eye splice is only suitable for 100% HMPE. It can only be used if the long end is free to be passed through the short end (point B below)*. When completed, the splice requires no additional stitching. The eye can also be made around a thimble, through a fitting, or both.

**If long part not is free to pass thru, see first part of instruction 595-821.*

Method

1. Feed line through fitting if required.


2. Make marks A and B as shown.

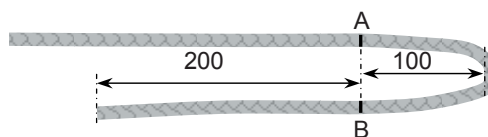


3. Feed the short end through the long part at A.




4. Feed the long part through the short end at B.

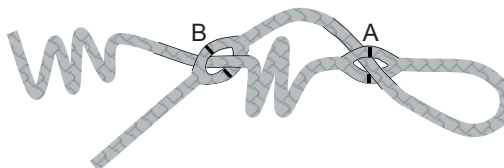

5. Pull the two loops together. Make a mark at C

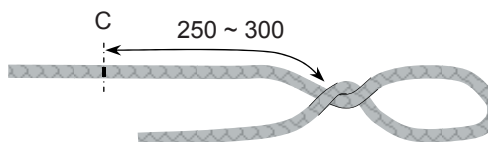

6. Feed the short end through the middle of the long part, to exit at C. Taper the short end by cutting 6 strands as shown.

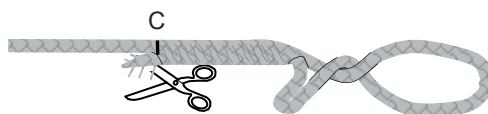

7. Smooth the long part to swallow the short end.



www.seldenmast.com